

ME-0741-PS-554-D

08-08


ESG3/IS

**375 SERIES EXTENDED  
SPRUE GATE NOZZLE  
INSTALLATION DATA  
REFER TO : MINI PRINT # 1800**




NOTE: Dimensions are shown in Inches.

NOTE:  
Before installing a Extended Sprue Gate Nozzle, it is important to take the nozzle's expansion factor into consideration. For best results, please follow the information below

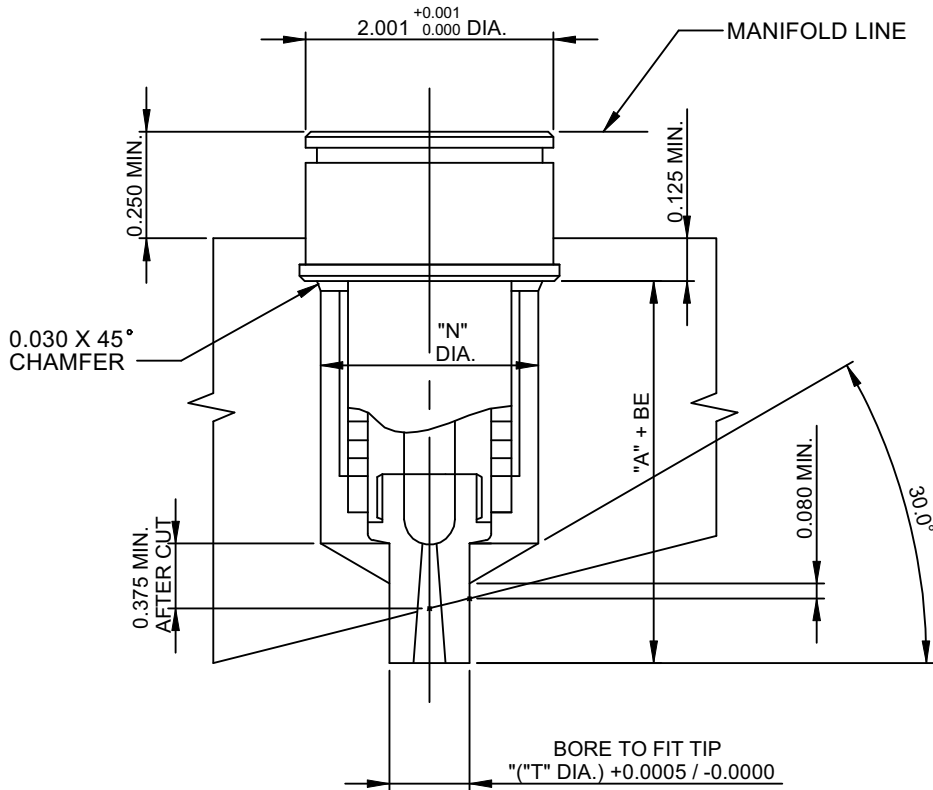

**MACHINING DIMENSIONS**

"N" Dia. (max.) Square Coil or Cast-In	"N" Dia. (min.) Square Coil or Cast-In
1.625	1.437

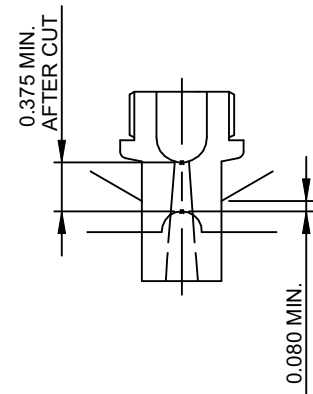

For selection of gate diameter it is important to take into consideration the materials flow characteristics, shear rate of resin, molding conditions, fill time requirements, gate vestiage, wall thickness and configuration of part to be molded. Situations requiring high injection velocities must be considered when selecting small gate diameters. High injection rates may require larger gates due to shear heat build up (e.g. high weight thin wall applications). See material manufactures literature for further information regarding material to be molded.

To compensate for the nozzle's growth when heat is applied, the linear expansion of the nozzle (BE) at a given temperature must be added to the nominal "A" dimension. The formulabelow shows how to figure boring depth (dimension "A" + BE).The tip of the nozzle will now be flush with cavity line.

Formula for determining this expansion factor is as follows:  
BE="A" dimension x 0.00000633 x (Nozzle set point temperature - 68°F).

EXAMPLE: Given a 3 inch "A" dimension, with a nozzle set point temperature of 500°F:  
BE = 3 x 0.00000633 x (500 - 68) = 0.008  
Thus "A" + BE will be 3.008

Note: The above information is only given as an example. variations may occur based on mold configurations and cooling factor. In some instances it may be necessary to obtain an empirical factor.

NOZZLE SUB-ASSEMBLY CATALOG NUMBER		"A" DIMENSION FOR NOZZLE ASSEMBLY
SQ.COIL HTR.	CAST-IN HTR.	
EHA0008	CIA0008	2.750
EHA0009	CIA0009	3.250
EHA0010	CIA0010	3.750
EHA0011	CIA0011	4.250
EHA0012	CIA0012	4.750
EHA0013	CIA0013	5.750
EHA0014	CIA0014	6.750
EHA0015	CIA0015	7.750

**WIRING INFORMATION**

Square Coil Heaters and Cast-In Heaters are supplied with 2" prestripped 36" long leads.  
Heaters are 240 VAC.  
2 power leads are Multi Color. 1 ground lead is GREEN.

Thermocouple is "J" Type. Thermocouple is supplied with 36" leads.


- 1 T/C lead is WHITE and negative (-) constantan (non-magnetic).
- 1 T/C lead is BLACK and positive (+) iron (magnetic).

**SPRUE GATE TIP SUB-ASSEMBLY**

CATALOG NUMBER	"T" DIA.
EHT0019	0.500
EHT0020	0.750
EHT0021	1.000

NOTE: Nozzle Assembly requires Nozzle Sub-assembly and Tip-assembly.

# 375 SERIES EXTENDED SPRUE GATE NOZZLE INSTALLATION DATA REFER TO : MINI PRINT # 1800

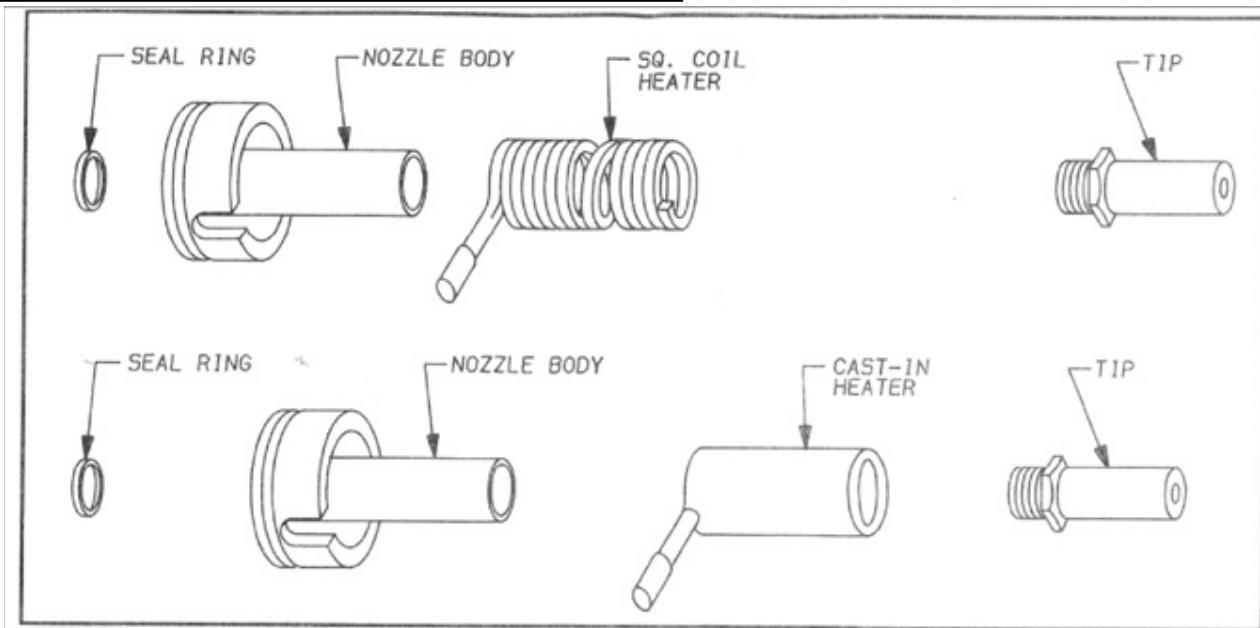

## OPERATING & SERVICING INSTRUCTIONS FOR 375 SERIES EXTENDED SPRUE GATE NOZZLES

All interchangeable nozzles are similar, and differ only in size and material flow capacity. The information found below applies to the 375 Series Extended sprue gate nozzles.

### OPERATING PROCEDURE

The nozzles are supplied with a Square (Flat) Coil or Cast-In heater equipped with a Type J Thermocouple.

It is recommended to use a D-M-E closed loop Temperature Controller for optimum Temperature Control.

When starting the nozzle, set the temperature to 10% voltage if using in open loop manual type or to 200 °F if using closed loop automatic type. In either case this procedure will allow the heater to dissipate any moisture.

Make sure you maintain this start-up setting for 15 minutes.

Controller equipped with Step Smart®, Smart Step®

or other heater warm-up circuitry will change automatically.

It is essential to use controllers with the proper voltage and wattage capabilities.

The voltage and wattage of each heater is clearly marked on the heater tag.

Step Smart®, Smart Start® and DME® are all registered trademarks of DME Company.

### DISASSEMBLY PROCEDURE

1. Place the nozzle in a vice using "V" Block, then secure it firmly at the nozzle head.
2. For removal of tip from nozzle, a six point deep well socket is recommended. The nozzle must be at processing temperature and the heater should be turned off when removing tip counter-clockwise from the nozzle. If nozzle is still in the mold, the nozzle must be "keyed" to prevent wire damages.
3. Tip must be cleaned of any material before reassembling.
4. Remove the heater using a Square Coil Heater wrench (Wrench is included with replacement heater).
5. Cast-in heater may be removed if failure occurs and replaced with a square coil heater. Follow assembly procedures for square coil heater.

### ASSEMBLY PROCEDURE

1. Nozzle body must be cleaned of any material in the seal off area and threaded areas before reassembling.
2. Install the heater using a Square Coil Heater wrench (Wrench included with replacement heater). After the heater is installed, it should cover the entire length of the nozzle body - stretch the heater by hand if necessary.
3. Apply an anti-seize compound on the tip threads.
4. Firmly screw the tip sub-assembly into the shank of the nozzle body. Tighten and untighten two or three times making sure there is a good contact between the tip and the shank. Torque the sub-assembly into the nozzle body using 30± 5 ft-lbs. For protection of the tip sub-assembly, a six point deep well socket is recommended.

D-M-E SHALL NOT BE LIABLE FOR MISUSE OR FAILURE TO FOLLOW THE ENCLOSED INSTRUCTIONS AND SPECIFICATIONS. D-M-E HERBY TO DISCLAIMS ALL IMPLIED WARRANTIES, INCLUDING MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. IN NO EVENT SHALL D-M-E BE RESPONSIBLE FOR LOSS OF USE, REVENUE OR PROFIT, OR FOR INCIDENTAL OR CONSEQUENTIAL DAMAGES.

6. Careful attention should be taken to the heater / thermocouple leads as damage could occur when working on nozzle assembly.

7. Seal ring for nozzle body must be replaced each time nozzle body and / or manifold are removed to ensure seal off.
8. Wait a minimum of 5 minutes after set point has been achieved for sufficient heat to transfer into the tip before molding.

## IMPORTANT SAFETY INFORMATION

A hot-runner system includes electrical elements and may contain molten plastic at elevated temperature and pressure. To avoid injury, exercise caution by reading these instructions before servicing or operating the system.

These instructions must be passed on to the end user where they should be read before using this product. Failure to do so can result in serious injury or death.



Failure to comply will result in serious injury or death:  
ELECTRICAL HAZARDS

Improper voltages or grounding can result in electrical shock. Use only with proper voltage and a proper earth ground.

To avoid electrical shock, do not operate product when wet.

Do not operate this equipment with covers or panels removed.

To avoid electrical shock, turn off main power disconnect and lockout / tag out before servicing this device. Do not connect temperature sensors to electrical power. It will damage the product and it can cause fire, severe injuries or even death.

If green ground wire present wire must be connected to the ground.

Do not rebend rigid leads. Rebending leads might result in damage to circuit.

Product might absorb moisture when cool. Use low Voltage or power to drive out residual moisture before applying full power. Failure to do so may cause damage to this product.



Failure to comply can result in serious injury or death:  
STORED ENERGY AND HIGH TEMPERATURE HAZARDS

This product maintains molten plastic at high pressure. Use caution when operating and servicing the system.

Physical contact with molten plastic may result in severe burns. Proper protective equipment, including eye protection, must be worn. This product has heated surfaces. Use caution when operating and servicing the system to avoid severe burns. Proper protective equipment should be worn.

## D-M-E COMPANY

29111 STEPHENSON HIGHWAY  
MADISON HEIGHTS  
MICHIGAN 48071 USA  
US 800-656-6656  
CANADA 800-387-6600  
www.dme.net